


Use Explain

Weighing



Press the "ON/OFF" key to turn the scale on.

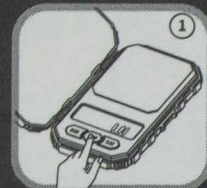

Put what you want to weigh in the middle of the weighing pan.




Press the "MODE" key to switch units.


Taring



Press the "ON/OFF" key to turn the scale on.

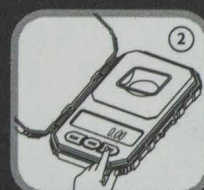

Press the "TARE" key to subtract the weight of an empty tray or container.

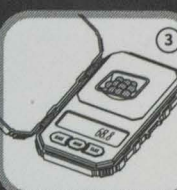

The display now only shows the weight of the weighing object.

Calibration




Press the "ON/OFF" key to turn the scale on.



Hold the "MODE" key until the display shows "CAL" then release.



The display will show the required calibration weight.

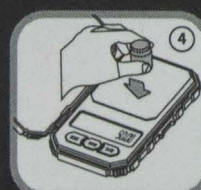

Place the required calibration weight on the center of the weighing pan.



The display will show "PASS" then return to normal weighing.



Calibration

You should use the calibration weights regularly to check the accuracy and adjust the calibration if necessary. The following steps will permanently adjust the scale calibration. Make sure to use the correct weighing when prompted.

